



SERVICE BULLETIN

Classification: EL20-033	Reference: NTB20-065	Date: September 16, 2020
-----------------------------	-------------------------	-----------------------------

2017-2019 ARMADA; ENGINE DOES NOT CRANK

APPLIED VEHICLES: 2017-2019 Armada (Y62)

IF YOU CONFIRM

The engine will not crank and will not start, but the battery test result is OK,

OR

One of these DTCs are stored:

- **C1142** (PRESS SENSOR)
- **C1A04** (ABS/TCS/VDC SYSTEM)
- **C1A26** (ECD MODE MALFUNCTION)

AND

The color of the stop lamp switch is solid black, as shown in Figure 1.



Figure 1

ACTION

Replace the stop lamp switch.

IMPORTANT: The purpose of ACTION (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire SERVICE PROCEDURE as it contains information that is essential to successfully completing this repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Replace and adjust the stop lamp switch.
 - For stop lamp switch replacement and adjustment, refer to the Electronic Service Manual (ESM), section **BRAKES > BRAKE SYSTEM > PERIODIC MAINTENANCE > BRAKE PEDAL.**

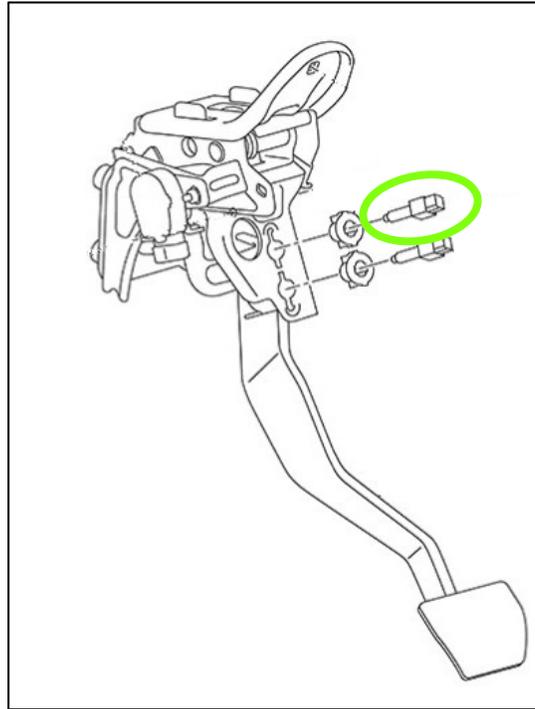


Figure 2

NOTE: The updated stop lamp switch will have a black body with a green connector end.



Figure 3

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
SWITCH ASSY – STOP LAMP	25320-AX10A	1

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
RPL STOP LAMP SWITCH	(1)	PF26AA	ZE	32	(2)

- (1) Reference the electronic parts catalog and use the Stop Lamp Switch Assy (25320-*****) as the Primary Failed Part (PFP).
- (2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated Flat Rate Time (FRT).

NOTE: The FRT allows adequate time to access DTC codes. No other diagnostic procedures subsequently required. Do Not claim any other diagnostic operation codes with this claim.

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
September 16, 2020	NTB20-065	Original bulletin published